

Service Intervention Report

Prepared 5 Sept 2026 · 3/3 sources included

Delivery coverage

3 of 3 charged sources produced a result (100%).

Sources received: 3 · Processed: 3 · Duplicate: 0 · Could not be read: 0 · Format not supported: 0 · No result recorded: 0

Every source received is accounted for and processed.

Service report

Purpose of the visit: entretien annuel chaudière gaz et défaut de pression circuit primaire · S003 · note-technicien.txt

Site: Résidence Les Tilleuls, bâtiment B, 12 rue des Tilleuls, 69003 Lyon · S003 · note-technicien.txt

Date: 31/07/2026 · S003 · note-technicien.txt

What the sources show

The photograph shows pipework with shut-off ball valves with red handles, a blue-rimmed dial indicator on the left, a central red-rimmed dial thermometer reading approximately 60 °C with printed markings "°C" and "Offen Auto", and another pressure gauge visible in the background. · from a photograph · S001 · 04-manometre-circuit.jpg

Maintenance intervention carried out on 31 juillet 2026 by technician L. Marchand for Résidence Les Tilleuls — Syndic Cabinet Roussel at chaufferie et CTA, bâtiment B. Tasks included 'Contrôle de la chaudière gaz murale : combustion, étanchéité gaz, sécurités', 'Nettoyage du corps de chauffe et remplacement du joint de porte de foyer', primary circuit repressurisation from 0,9 bar to 1,6 bar, replacement of the G4 filter on the air handling unit, and checks on the outdoor AC unit with recommissioning at 12h30. Parts installed include 'Joint de porte de foyer, tresse céramique', two 'Filtre plan G4 592 x 592 x 48 mm', and 'Inhibiteur de corrosion circuit chauffage, 1 L', totaling 483,30 € net, 20% VAT (96,66 €), and 579,96 € gross. · stated in a document · S002 · bon-intervention-bi-2026-0731.pdf

Annual maintenance carried out by L. Marchand on 31/07/2026. For the Chappée Luna 24 kW gas boiler: cleaned heating body, replaced foyer door seal (ref JT-FOY-88), repressurised from 0,9 bar to 1,6 bar, bled hall radiators, combustion analysis compliant. For rooftop CTA: replaced very dirty G4 filter with 2 new filters, checked belt tension, condensate tray clean. For Daikin outdoor unit: fins cleaned, no leaks. Vase d'expansion requires replacement; return isolation valve shows early corrosion. · stated in a document · S003 · note-technicien.txt

Still open

Status stated in the sources for 3 of 3 items; 0 have no stated status.

Vase d'expansion du circuit primaire : pré-gonflage à 0,4 bar au lieu de 1,0 bar. Remplacement recommandé, devis à établir. Non réalisé ce jour; trace de corrosion sur la vanne d'isolement retour, à surveiller; photo « après » du groupe extérieur non prise : accès terrasse fermé à clé. · S002 · bon-intervention-bi-2026-0731.pdf

Vase d'expansion pre-gonfle a 0,4 bar only instead of 1,0 bar, replacement recommended (estimated around 420 euros net) but not done due to lack of stock. Photo après of outdoor AC unit missing because the terrace was locked by the caretaker. · S003 · note-technicien.txt

Handover

Engineer: _____ Date: _____

Customer: _____ Date: _____

This document is not signed. It is for both parties to sign together; it carries no electronic signature and makes no claim about legal or regulatory validity.

Overview

Sources processed: 3

Validated: 3

Exceptions: 0

Source index

S001 · 04-manometre-circuit.jpg · Source kind: image · Result status: included

S002 · bon-intervention-bi-2026-0731.pdf · Source kind: pdf · Result status: included

S003 · note-technicien.txt · Source kind: text · Result status: included

Items needing review

Vase d'expansion du circuit primaire : pré-gonflage à 0,4 bar au lieu de 1,0 bar. Remplacement recommandé, devis à établir. Non réalisé ce jour; trace de corrosion sur la vanne d'isolement retour, à surveiller; photo « après » du groupe extérieur non prise : accès terrasse fermé à clé. · S002 ·

bon-intervention-bi-2026-0731.pdf

Vase d'expansion pre-gonfle a 0,4 bar only instead of 1,0 bar, replacement recommended (estimated around 420 euros net) but not done due to lack of stock. Photo après of outdoor AC unit missing because the terrace was locked by the caretaker. · S003 · note-technicien.txt

Maintenance intervention carried out on 31 juillet 2026 by technician L. Marchand for Résidence Les Tilleuls — Syndic Cabinet Roussel at chaufferie et CTA, bâtiment B. Tasks included 'Contrôle de la chaudière gaz murale : combustion, étanchéité gaz, sécurités', 'Nettoyage du corps de chauffe et remplacement du joint de porte de foyer', primary circuit repressurisation from 0,9 bar to 1,6 bar, replacement of the G4 filter on the air handling unit, and checks on the outdoor AC unit with recommissioning at 12h30. Parts installed include 'Joint de porte de foyer, tresse céramique', two 'Filtre plan G4 592 x 592 x 48 mm', and 'Inhibiteur de corrosion circuit chauffage, 1 L', totaling 483,30 € net, 20% VAT (96,66 €), and 579,96 € gross.

Vase d'expansion pre-gonfle a 0,4 bar only instead of 1,0 bar, replacement recommended (estimated around 420 euros net) but not done due to lack of stock. Photo après of outdoor AC unit missing because the terrace was locked by the caretaker.

These are computed check results. No person has reviewed this delivery.

Draft prepared from supplied files. Confirm material decisions against the linked source evidence. No currency or unit conversion is performed.

Technical appendix

Everything below is the audit trail: what the job was configured to do and the exact digests behind each source. The report you need is above it.

Locked scope

Locked scope: unlocked
Requested goal: None
Applied goal: send-client
Selected sections: None
Emitted sections: scope, warnings, overview, photo_work_completed, photo_evidence, photo_issues, photo_materials, source_index, evidence_index, exceptions
Deterministic aggregation: no cross-document monetary total
Deterministic ranking: highest-confidence findings first
Warnings: None

Source index · Source SHA-256

S001 · 04-manometre-circuit.jpg · 6f08e3594c8cc79d126a97edac68d952dd3b3e1ed5e066bd58f2731690c8f067
S002 · bon-intervention-bi-2026-0731.pdf · 8d3bf4ef1908f8413d5a3a8843722f2a1560112971e39bc44cf38b13985dd439
S003 · note-technicien.txt · cc77deb414f60d8e2f758eafde5066fd20b0b85c63c205bb867c5609956e4c3a

Evidence index

ev_2376f5fcbd27247704889805bf96663a · summary · S003 · note-technicien.txt:lines 38-38
ev_2ef3fc05e98e1bace2225687c7da8600 · observableDetail · S001 · 04-manometre-circuit.jpg:region 0.390,0.400,0.240,0.460
ev_3c3a76fd7121a6b7065506bcd60f0e05 · issue · S003 · note-technicien.txt:lines 29-32
ev_5728890d8058694cca3cf8f8cf305978 · observableDetail · S002 · bon-intervention-bi-2026-0731.pdf:p1
ev_62819bb9226c10aa22dea47740569d86 · issue · S003 · note-technicien.txt:lines 25-26
ev_64c2de1f77afae329201119e2a793135 · summary · S003 · note-technicien.txt:lines 1-1
ev_660b85fa2fcd995515f8c2d71f57f4eb · observableDetail · S003 · note-technicien.txt:lines 13-13
ev_67b918988dfd7c8d9a0569b347a68d92 · summary · S001 · 04-manometre-circuit.jpg:region 0.390,0.400,0.240,0.460
ev_789dc603049cbbdcf7e9f997c3705c9e · observableDetail · S003 · note-technicien.txt:lines 14-14
ev_871eed2f892ef209c93bab25eeb5240 · observableDetail · S003 · note-technicien.txt:lines 10-10
ev_af82500de0b93ee564c9db996183ad1b · summary · S002 · bon-intervention-bi-2026-0731.pdf:p1
ev_c8813e951af554efce113e672f2cab82 · observableDetail · S003 · note-technicien.txt:lines 6-6

Bounded photo evidence

Original customer files are not copied into this evidence pack; only bounded, metadata-free image previews are included.

S001 · 04-manometre-circuit.jpg

image · 6f08e3594c8c

